

Boring Designation VB-FC18-13

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A			9. SIZE AND TYPE OF BIT See Remarks	
2. BORING DESIGNATION VB-FC18-13		LOCATION COORDINATES X = 666,850 Y = 1,903,160		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)
3. DRILLING AGENCY Corps of Engineers - CESAJ		CONTRACTOR FILE NO.		HORIZONTAL NAD83
4. NAME OF DRILLER			11. MANUFACTURER'S DESIGNATION OF DRILL <input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER	
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED			12. TOTAL SAMPLES 4	
6. THICKNESS OF OVERBURDEN N/A			13. TOTAL NUMBER CORE BOXES 2	
7. DEPTH DRILLED INTO ROCK N/A			14. ELEVATION GROUND WATER	
8. TOTAL DEPTH OF BORING 20.0 Ft.			15. DATE BORING 01-01-19	
			16. ELEVATION TOP OF BORING -57.8 Ft.	
			17. TOTAL RECOVERY FOR BORING 100 %	
			18. SIGNATURE AND TITLE OF INSPECTOR	

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE
-57.8	0.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, few sand to gravel-sized shell, trace silt, 10Y 5/1 greenish gray (SP)	100			-57.8		
					1		Vibracore		
					100		Vibracore		
-62.8	5.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, trace silt, 10Y 5/1 greenish gray (SP)		2		-62.8		
							Vibracore		
					100		Vibracore		
-64.8	7.0	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, 10Y 5/1 greenish gray (SP)		3		-66.8		
							Vibracore		
					100		Vibracore		
-67.8	10.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, trace silt, 10Y 5/2 dark greenish gray (SP)		4		-71.8		
							Vibracore		
					100		Vibracore		
-70.1	12.3	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, little fine to medium-grained sand-sized shell, trace silt, 10Y 5/2 dark greenish gray (SP)						
-72.8	15.0			100					

DRILLING LOG (Cont. Sheet)			INSTALLATION Jacksonville District			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 666,850 Y = 1,903,160			ELEVATION TOP OF BORING -57.8 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE																		
-77.8	20.0		SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few silt, trace shell, 10Y 5/2 dark greenish gray (SP-SM)	100			Vibracore																				
			<p>NOTES:</p> <ol style="list-style-type: none"> USACE Jacksonville is the custodian for these original files. Soils are field visually classified in accordance with the Unified Soils Classification System. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>5.0/5.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>9.0/9.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>14.0/14.5</td> <td>SP*</td> </tr> </tbody> </table> <p>*Lab visual classification based on gradation curve</p>	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	1	1.0/1.5	SP*	2	5.0/5.5	SP*	3	9.0/9.5	SP*	4	14.0/14.5	SP*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
1	1.0/1.5	SP*																									
2	5.0/5.5	SP*																									
3	9.0/9.5	SP*																									
4	14.0/14.5	SP*																									

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A		9. SIZE AND TYPE OF BIT See Remarks		
2. BORING DESIGNATION VB-FC18-14		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83
3. DRILLING AGENCY Corps of Engineers - CESAJ		11. MANUFACTURER'S DESIGNATION OF DRILL		<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
4. NAME OF DRILLER		12. TOTAL SAMPLES		DISTURBED 4
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		13. TOTAL NUMBER CORE BOXES		UNDISTURBED (UD) 0
6. THICKNESS OF OVERBURDEN N/A		14. ELEVATION GROUND WATER		
7. DEPTH DRILLED INTO ROCK N/A		15. DATE BORING		STARTED 01-01-19
8. TOTAL DEPTH OF BORING 20.0 Ft.		16. ELEVATION TOP OF BORING		COMPLETED 01-01-19
		17. TOTAL RECOVERY FOR BORING		95 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE	
-54.1	0.0	[Dotted Pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, 10Y 6/1 greenish gray (SP)	100			-54.1			
					1			-56.1		
					100			Vibracore		
						2		-60.1		
-63.1	9.0	[Dotted Pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, 10YR 5/1 gray (SP)	100			-64.1			
					3			Vibracore		
					100			-68.1		
-67.1	13.0	[Dotted Pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, few fine to coarse-grained sand-sized shell, trace silt, 10YR 5/1 gray (SP)	100						
-68.1	14.0				4			Vibracore		
			SAND, poorly-graded, mostly fine-grained sand-sized quartz, few fine to	100						

DRILLING LOG (Cont. Sheet)			INSTALLATION			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 667,502 Y = 1,903,875			ELEVATION TOP OF BORING -54.1 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-73.1	19.0	•••••	medium-grained sand-sized shell, trace silt, 10YR 5/1 gray (SP)	100			Vibracore																				
-74.1	20.0	NR		0			Vibracore (No Recovery)																				
			NOTES: 1. USACE Jacksonville is the custodian for these original files. 2. Soils are field visually classified in accordance with the Unified Soils Classification System. 3. Lost during recovery at depth 19'-20'. 4. Laboratory Testing Results <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>2.0/2.5</td> <td>SP*</td> </tr> <tr> <td>1</td> <td>2.0/2.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>6.0/6.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>10.0/10.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>14.0/14.5</td> <td>SP*</td> </tr> </tbody> </table> *Lab visual classification based on gradation curve	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	2.0/2.5	SP*	1	2.0/2.5	SP*	2	6.0/6.5	SP*	3	10.0/10.5	SP*	4	14.0/14.5	SP*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	2.0/2.5	SP*																									
1	2.0/2.5	SP*																									
2	6.0/6.5	SP*																									
3	10.0/10.5	SP*																									
4	14.0/14.5	SP*																									

Boring Designation VB-FC18-15

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A		9. SIZE AND TYPE OF BIT See Remarks		
2. BORING DESIGNATION VB-FC18-15		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83
3. DRILLING AGENCY Corps of Engineers - CESAJ		11. MANUFACTURER'S DESIGNATION OF DRILL		<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
4. NAME OF DRILLER		12. TOTAL SAMPLES		DISTURBED 4
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		13. TOTAL NUMBER CORE BOXES		UNDISTURBED (UD) 0
6. THICKNESS OF OVERBURDEN N/A		14. ELEVATION GROUND WATER		
7. DEPTH DRILLED INTO ROCK N/A		15. DATE BORING		STARTED 01-01-19
8. TOTAL DEPTH OF BORING 20.0 Ft.		16. ELEVATION TOP OF BORING		COMPLETED 01-01-19
		17. TOTAL RECOVERY FOR BORING		95 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE	
-53.3	0.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, trace silt, 10Y 6/1 greenish gray (SP)	100			-53.3			
					1			-54.3		
					100			-57.3		
						2				
				100			-61.3			
-62.3	9.0	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, few fine to medium-grained sand-sized shell, trace silt, 10Y 4/1 dark greenish gray (SP)	100						
						3				
				100			-64.3			
					4					
-67.3	14.0	[Dotted pattern]	SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few fine to coarse-grained sand-sized shell, few silt,	100						

DRILLING LOG (Cont. Sheet)			INSTALLATION Jacksonville District			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 668,152 Y = 1,904,661			ELEVATION TOP OF BORING -53.3 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-70.3	17.0		10Y 4/1 dark greenish gray (SP-SM)	100			Vibracore																				
-72.3	19.0		SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, trace silt, 10Y 5/1 greenish gray (SP)																								
-73.3	20.0	NR		0			Vibracore (No Recovery)																				
<p>NOTES:</p> <ol style="list-style-type: none"> USACE Jacksonville is the custodian for these original files. Soils are field visually classified in accordance with the Unified Soils Classification System. Lost during recovery at depth 19'-20'. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>4.0/4.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>4.0/4.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>8.0/8.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>11.0/11.5</td> <td>SP*</td> </tr> </tbody> </table> <p>*Lab visual classification based on gradation curve</p>										SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	2	4.0/4.5	SP*	2	4.0/4.5	SP*	3	8.0/8.5	SP*	4	11.0/11.5	SP*
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
2	4.0/4.5	SP*																									
2	4.0/4.5	SP*																									
3	8.0/8.5	SP*																									
4	11.0/11.5	SP*																									

DRILLING LOG (Cont. Sheet)			INSTALLATION			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 667,607 Y = 1,902,489			ELEVATION TOP OF BORING -56.5 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-76.5	20.0		SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, few silt, 10Y 4/1 dark greenish gray (SP-SM)	100			Vibracore																				
			NOTES: 1. USACE Jacksonville is the custodian for these original files. 2. Soils are field visually classified in accordance with the Unified Soils Classification System. 3. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>6.0/6.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>6.0/6.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>11.0/11.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>14.0/14.5</td> <td>SP*</td> </tr> </tbody> </table> *Lab visual classification based on gradation curve	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	2	6.0/6.5	SP*	2	6.0/6.5	SP*	3	11.0/11.5	SP*	4	14.0/14.5	SP*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
2	6.0/6.5	SP*																									
2	6.0/6.5	SP*																									
3	11.0/11.5	SP*																									
4	14.0/14.5	SP*																									

Boring Designation VB-FC18-19

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A		9. SIZE AND TYPE OF BIT See Remarks		
2. BORING DESIGNATION VB-FC18-19		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83
3. DRILLING AGENCY Corps of Engineers - CESAJ		11. MANUFACTURER'S DESIGNATION OF DRILL		<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
4. NAME OF DRILLER		12. TOTAL SAMPLES		DISTURBED 5
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		13. TOTAL NUMBER CORE BOXES		UNDISTURBED (UD) 0
6. THICKNESS OF OVERBURDEN N/A		14. ELEVATION GROUND WATER		
7. DEPTH DRILLED INTO ROCK N/A		15. DATE BORING		STARTED 01-01-19
8. TOTAL DEPTH OF BORING 20.0 Ft.		16. ELEVATION TOP OF BORING		COMPLETED 01-01-19
		17. TOTAL RECOVERY FOR BORING		100 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE	
-54.2	0.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, 10Y 6/1 greenish gray (SP)	100			-54.2			
					1			-56.2		
					100					
						2				
-59.2	5.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to coarse-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, 10Y 6/1 greenish gray (SP)	100			-60.2			
					3					
					100					
						4				
-64.2	10.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, shell size up to 3", 10Y 6/1 greenish gray (SP)	100			-64.2			
-67.2	13.0	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, few silt, few fine to medium-grained sand-sized shell, 10Y 6/1 greenish gray (SP)	100			-68.2			
-69.2	15.0			100						

DRILLING LOG (Cont. Sheet)			INSTALLATION			SHEET 2 OF 2 SHEETS																								
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																								
LOCATION COORDINATES X = 668,260 Y = 1,903,257			ELEVATION TOP OF BORING -54.2 Ft.																											
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																					
-71.2	17.0		SAND, poorly-graded, mostly fine-grained sand-sized quartz, trace silt, trace shell, shell size up to 3", 10Y 5/1 greenish gray (SP)	100			Vibracore																							
					5																									
-74.2	20.0		SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few silt, trace shell, shell size up to 3", 10Y 5/1 greenish gray (SP-SM)	100			Vibracore																							
			NOTES: 1. USACE Jacksonville is the custodian for these original files. 2. Soils are field visually classified in accordance with the Unified Soils Classification System. 3. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr><td>1</td><td>2.0/2.5</td><td>SP*</td></tr> <tr><td>2</td><td>6.0/6.5</td><td>SP*</td></tr> <tr><td>2</td><td>6.0/6.5</td><td>SP*</td></tr> <tr><td>3</td><td>10.0/10.5</td><td>SP*</td></tr> <tr><td>4</td><td>14.0/14.5</td><td>SP*</td></tr> <tr><td>5</td><td>16.0/16.5</td><td>SP*</td></tr> </tbody> </table> *Lab visual classification based on gradation curve	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	2.0/2.5	SP*	2	6.0/6.5	SP*	2	6.0/6.5	SP*	3	10.0/10.5	SP*	4	14.0/14.5	SP*	5	16.0/16.5	SP*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																												
1	2.0/2.5	SP*																												
2	6.0/6.5	SP*																												
2	6.0/6.5	SP*																												
3	10.0/10.5	SP*																												
4	14.0/14.5	SP*																												
5	16.0/16.5	SP*																												

Boring Designation VB-FC18-20

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A			9. SIZE AND TYPE OF BIT See Remarks	
2. BORING DESIGNATION VB-FC18-20		LOCATION COORDINATES X = 668,944 Y = 1,904,009		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)
3. DRILLING AGENCY Corps of Engineers - CESAJ		CONTRACTOR FILE NO.		HORIZONTAL NAD83
4. NAME OF DRILLER		11. MANUFACTURER'S DESIGNATION OF DRILL		VERTICAL NAVD88
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		DEG. FROM VERTICAL	BEARING	<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
6. THICKNESS OF OVERBURDEN N/A		12. TOTAL SAMPLES		DISTURBED 4
7. DEPTH DRILLED INTO ROCK N/A		13. TOTAL NUMBER CORE BOXES 2		UNDISTURBED (UD) 0
8. TOTAL DEPTH OF BORING 20.0 Ft.		14. ELEVATION GROUND WATER		15. DATE BORING
				STARTED 01-01-19
				COMPLETED 01-01-19
		16. ELEVATION TOP OF BORING -55.4 Ft.		17. TOTAL RECOVERY FOR BORING 88 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE
-55.4	0.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to medium-grained sand-sized shell, trace silt, 5Y 6/1 gray (SP)	100			-55.4		
					1		Vibracore		
					100		Vibracore		
					2		Vibracore		
-62.9	7.5	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, few fine to coarse-grained sand-sized shell, trace silt, 10Y 6/1 greenish gray (SP)	100			-59.4		
					3		Vibracore		
					100		Vibracore		
-66.3	10.9	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, few sand to cobble-sized shell, trace silt, trace metal debris up to 0.8" @ 14.5' depth, 10Y 5/1 greenish gray (SP)	100			-63.4		
					4		Vibracore		
-68.4	13.0	[Dotted pattern]	SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few fine to medium-grained sand-sized shell, trace silt, 10Y 5/1 greenish gray (SP-SM)	100			-67.4		

DRILLING LOG (Cont. Sheet)			INSTALLATION Jacksonville District			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 668,944 Y = 1,904,009			ELEVATION TOP OF BORING -55.4 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-72.9	17.5			100			Vibracore																				
-75.4	20.0	NR		0			Vibracore (No Recovery)																				
			NOTES: 1. USACE Jacksonville is the custodian for these original files. 2. Soils are field visually classified in accordance with the Unified Soils Classification System. 3. Lost during recovery at depth 17.5'-20'. 4. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>4.0/4.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>8.0/8.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>12.0/12.5</td> <td>SP*</td> </tr> </tbody> </table> *Lab visual classification based on gradation curve	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	1	1.0/1.5	SP*	2	4.0/4.5	SP*	3	8.0/8.5	SP*	4	12.0/12.5	SP*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
1	1.0/1.5	SP*																									
2	4.0/4.5	SP*																									
3	8.0/8.5	SP*																									
4	12.0/12.5	SP*																									

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A		9. SIZE AND TYPE OF BIT See Remarks		
2. BORING DESIGNATION VB-FC18-23		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83
3. DRILLING AGENCY Corps of Engineers - CESAJ		11. MANUFACTURER'S DESIGNATION OF DRILL		<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
4. NAME OF DRILLER		12. TOTAL SAMPLES		DISTURBED 4
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		13. TOTAL NUMBER CORE BOXES		UNDISTURBED (UD) 0
6. THICKNESS OF OVERBURDEN N/A		14. ELEVATION GROUND WATER		
7. DEPTH DRILLED INTO ROCK N/A		15. DATE BORING		STARTED 01-01-19
8. TOTAL DEPTH OF BORING 20.0 Ft.		16. ELEVATION TOP OF BORING		COMPLETED 01-01-19
		17. TOTAL RECOVERY FOR BORING		100 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE	
-52.5	0.0	[Dotted Pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to medium-grained sand-sized shell, trace silt, 5Y 6/1 gray (SP)	100			-52.5			
					1			Vibracore		
					100			Vibracore		
						2				
				100			Vibracore			
-62.5	10.0	[Dotted Pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to medium-grained sand-sized shell, trace silt, 10YR 5/1 gray (SP)		3		-62.5			
								Vibracore		
						4				
				100			Vibracore			
-67.5	15.0			100			-66.5			
							Vibracore			

DRILLING LOG (Cont. Sheet)			INSTALLATION			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 668,366 Y = 1,901,850			ELEVATION TOP OF BORING -52.5 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-72.5	20.0		SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few fine to medium-grained sand-sized shell, few silt, 10YR 5/1 gray (SP-SM) From El. -68.5 to -72.5 Ft., mostly fine-grained sand-sized quartz, few silt, trace shell, 10YR 5/1 gray	100			Vibracore																				
			<p>NOTES:</p> <ol style="list-style-type: none"> USACE Jacksonville is the custodian for these original files. Soils are field visually classified in accordance with the Unified Soils Classification System. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>5.0/5.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>10.0/10.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>14.0/14.5</td> <td>SP*</td> </tr> </tbody> </table> <p>*Lab visual classification based on gradation curve</p>	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	1	1.0/1.5	SP*	2	5.0/5.5	SP*	3	10.0/10.5	SP*	4	14.0/14.5	SP*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
1	1.0/1.5	SP*																									
2	5.0/5.5	SP*																									
3	10.0/10.5	SP*																									
4	14.0/14.5	SP*																									

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A			9. SIZE AND TYPE OF BIT See Remarks	
2. BORING DESIGNATION VB-FC18-24		LOCATION COORDINATES X = 668,987 Y = 1,902,578		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)
3. DRILLING AGENCY Corps of Engineers - CESAJ		CONTRACTOR FILE NO.		HORIZONTAL NAD83
4. NAME OF DRILLER		11. MANUFACTURER'S DESIGNATION OF DRILL		VERTICAL NAVD88
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		DEG. FROM VERTICAL	BEARING	<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
6. THICKNESS OF OVERBURDEN N/A		12. TOTAL SAMPLES		DISTURBED 4
7. DEPTH DRILLED INTO ROCK N/A		13. TOTAL NUMBER CORE BOXES 2		UNDISTURBED (UD) 0
8. TOTAL DEPTH OF BORING 20.0 Ft.		14. ELEVATION GROUND WATER		15. DATE BORING
				STARTED 01-01-19
				COMPLETED 01-01-19
		16. ELEVATION TOP OF BORING -52.6 Ft.		17. TOTAL RECOVERY FOR BORING 100 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

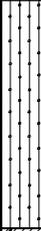
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE	
-52.6	0.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, trace silt, 10YR 6/1 gray (SP)	100			-52.6		0	
					1			-53.6		
					100					
						2		-57.6		
				100					5	
-62.6	10.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, 5Y 6/1 gray (SP)	100			-62.6		10	
					3					
						4		-66.6		
				100					15	
-65.6	13.0		SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, trace silt, 5Y 6/1 gray (SP)							
-66.9	14.3		SAND, poorly-graded, mostly fine-grained sand-sized quartz, little fine to							

DRILLING LOG (Cont. Sheet)			INSTALLATION			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 668,987 Y = 1,902,578			ELEVATION TOP OF BORING -52.6 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-69.4	16.8		coarse-grained sand-sized shell, trace silt, 5Y 5/1 gray (SP)																								
-72.6	20.0		SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few sand to gravel-sized shell, few silt, 5Y 5/1 gray (SP-SM)	100			Vibracore																				
			<p>NOTES:</p> <ol style="list-style-type: none"> USACE Jacksonville is the custodian for these original files. Soils are field visually classified in accordance with the Unified Soils Classification System. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>5.0/5.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>5.0/5.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>10.0/10.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>14.0/14.5</td> <td>SP*</td> </tr> </tbody> </table> <p>*Lab visual classification based on gradation curve</p>	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	2	5.0/5.5	SP*	2	5.0/5.5	SP*	3	10.0/10.5	SP*	4	14.0/14.5	SP*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
2	5.0/5.5	SP*																									
2	5.0/5.5	SP*																									
3	10.0/10.5	SP*																									
4	14.0/14.5	SP*																									

Boring Designation VB-FC18-25

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A			9. SIZE AND TYPE OF BIT See Remarks	
2. BORING DESIGNATION VB-FC18-25		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83
3. DRILLING AGENCY Corps of Engineers - CESAJ		11. MANUFACTURER'S DESIGNATION OF DRILL		<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
4. NAME OF DRILLER		12. TOTAL SAMPLES		DISTURBED 3
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		13. TOTAL NUMBER CORE BOXES		2
6. THICKNESS OF OVERBURDEN N/A		14. ELEVATION GROUND WATER		
7. DEPTH DRILLED INTO ROCK N/A		15. DATE BORING		STARTED 01-01-19
8. TOTAL DEPTH OF BORING 20.0 Ft.		16. ELEVATION TOP OF BORING		-57.1 Ft.
		17. TOTAL RECOVERY FOR BORING		100 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE
-57.1	0.0						-57.1		
-58.1	1.0		SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, few shell, trace silt, 5Y 6/1 gray (SP)	100			Vibracore		
			SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, some sand to gravel-sized shell, trace silt, 5Y 6/1 gray (SP)	100	1		Vibracore		
-62.1	5.0						-62.1		
			SAND, poorly-graded, mostly fine-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, trace silt, 5Y 5/1 gray (SP)	100	2		Vibracore		
-67.1	10.0						-65.1		
-67.9	10.8		SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, little fine to coarse-grained sand-sized shell, few silt, 10Y 6/1 greenish gray (SP-SM)	100			Vibracore		
-69.4	12.3		CLAY, fat, little fine-grained sand-sized quartz, few fine to coarse-grained sand-sized shell, 5GY 4/1 dark greenish gray (CH)						
			SAND, silty, mostly fine-grained sand-sized quartz, little silt, few fine to medium-grained sand-sized shell, 10Y 5/1 greenish gray (SM)						
			From El. -70.4 to -71.3 Ft., some fine-grained sand-sized quartz, some sand to gravel-sized shell, little silt, 10Y 5/1 greenish gray						
			From El. -71.3 to -75.1 Ft., mostly						

DRILLING LOG (Cont. Sheet)			INSTALLATION Jacksonville District			SHEET 2 OF 2 SHEETS																		
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																		
LOCATION COORDINATES X = 669,671 Y = 1,903,365			ELEVATION TOP OF BORING -57.1 Ft.																					
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE															
-75.1	18.0		fine-grained sand-sized quartz, little silt, trace shell, 10Y 5/1 greenish gray	100			Vibracore																	
-77.1	20.0		SAND, clayey, mostly fine-grained sand-sized quartz, little sand to gravel-sized shell, little clay, 10Y 4/1 dark greenish gray (SC)				-77.1																	
<p>NOTES:</p> <ol style="list-style-type: none"> USACE Jacksonville is the custodian for these original files. Soils are field visually classified in accordance with the Unified Soils Classification System. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>5.0/5.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>5.0/5.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>8.0/8.5</td> <td>SP*</td> </tr> </tbody> </table> <p>*Lab visual classification based on gradation curve</p>										SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	2	5.0/5.5	SP*	2	5.0/5.5	SP*	3	8.0/8.5	SP*
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																						
1	1.0/1.5	SP*																						
2	5.0/5.5	SP*																						
2	5.0/5.5	SP*																						
3	8.0/8.5	SP*																						

Boring Designation VB-FC18-28

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A		9. SIZE AND TYPE OF BIT See Remarks		
2. BORING DESIGNATION VB-FC18-28		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		
3. DRILLING AGENCY Corps of Engineers - CESAJ		11. MANUFACTURER'S DESIGNATION OF DRILL <input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER		
4. NAME OF DRILLER		12. TOTAL SAMPLES DISTURBED: 4 UNDISTURBED (UD): 0		
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		13. TOTAL NUMBER CORE BOXES 2		
6. THICKNESS OF OVERBURDEN N/A		14. ELEVATION GROUND WATER		
7. DEPTH DRILLED INTO ROCK N/A		15. DATE BORING STARTED: 01-01-19 COMPLETED: 01-01-19		
8. TOTAL DEPTH OF BORING 20.0 Ft.		16. ELEVATION TOP OF BORING -61.6 Ft.		
		17. TOTAL RECOVERY FOR BORING 100 %		
		18. SIGNATURE AND TITLE OF INSPECTOR		

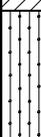
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE		
-61.6	0.0	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, 5Y 7/1 light gray (SP)	100			-61.6				
						1		-62.6			
						100			Vibracore		
-65.1	3.5				SAND, poorly-graded, mostly fine-grained sand-sized quartz, little fine to medium-grained sand-sized shell, trace silt, 5Y 6/1 gray (SP)				-65.6		
				100			Vibracore				
-68.6	7.0	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, little fine to medium-grained sand-sized shell, trace silt, 10Y 5/1 greenish gray (SP)				-68.6				
-69.1	7.5					2					
						100			Vibracore		
			SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few silt, trace shell, 10Y 5/1 greenish gray (SP-SM)								
-71.6	10.0			100			-71.6				
			SAND, poorly-graded with silt, mostly sand to gravel-sized shell, some fine-grained sand-sized quartz, few silt, 10Y 4/1 dark greenish gray (SP-SM)								
-73.4	11.8										
			SAND, poorly-graded with silt, mostly fine-grained sand-sized quartz, few silt, few fine to medium-grained sand-sized shell, 10Y 4/1 dark greenish gray (SP-SM)								
				100			Vibracore				
-76.6	15.0										

DRILLING LOG (Cont. Sheet)			INSTALLATION			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 669,111 Y = 1,901,275			ELEVATION TOP OF BORING -61.6 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-79.8	18.2		SAND, poorly-graded with silt, mostly sand to gravel-sized shell, some quartz, few silt, 10Y 6/1 greenish gray (SP-SM)	100			Vibracore																				
-81.6	20.0		SAND, silty, mostly fine-grained sand-sized quartz, little silt, few fine to coarse-grained sand-sized shell, 10Y 4/1 dark greenish gray (SM) From El. -80.4 to -81.6 Ft., some fine-grained sand-sized quartz, some fine to coarse-grained sand-sized shell, little silt, 10Y 4/1 dark greenish gray				-81.6																				
			<p>NOTES:</p> <ol style="list-style-type: none"> USACE Jacksonville is the custodian for these original files. Soils are field visually classified in accordance with the Unified Soils Classification System. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>4.0/4.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>4.0/4.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>7.0/7.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>10.0/10.5</td> <td>SP-SM*</td> </tr> </tbody> </table> <p>*Lab visual classification based on gradation curve</p>	SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	2	4.0/4.5	SP*	2	4.0/4.5	SP*	3	7.0/7.5	SP*	4	10.0/10.5	SP-SM*						
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
2	4.0/4.5	SP*																									
2	4.0/4.5	SP*																									
3	7.0/7.5	SP*																									
4	10.0/10.5	SP-SM*																									

Boring Designation VB-FC18-29

DRILLING LOG		DIVISION South Atlantic	INSTALLATION Jacksonville District	SHEET 1 OF 2 SHEETS
1. PROJECT Flagler HSDR Offshore Sand Sources 3A		9. SIZE AND TYPE OF BIT See Remarks		
2. BORING DESIGNATION VB-FC18-29		10. COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83
3. DRILLING AGENCY Corps of Engineers - CESAJ		11. MANUFACTURER'S DESIGNATION OF DRILL		<input type="checkbox"/> AUTO HAMMER <input type="checkbox"/> MANUAL HAMMER
4. NAME OF DRILLER		12. TOTAL SAMPLES		DISTURBED 4
5. DIRECTION OF BORING <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED		13. TOTAL NUMBER CORE BOXES		UNDISTURBED (UD) 0
6. THICKNESS OF OVERBURDEN N/A		14. ELEVATION GROUND WATER		
7. DEPTH DRILLED INTO ROCK N/A		15. DATE BORING		STARTED 01-03-19
8. TOTAL DEPTH OF BORING 20.0 Ft.		16. ELEVATION TOP OF BORING		COMPLETED 01-03-19
		17. TOTAL RECOVERY FOR BORING		100 %
		18. SIGNATURE AND TITLE OF INSPECTOR		

ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/1 FT.	N-VALUE	
-58.7	0.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, little sand to gravel-sized shell, trace silt, 5Y 5/1 gray (SP)	100			-58.7			
					1			-59.7		
					100					
-63.7	5.0	[Dotted pattern]	SAND, poorly-graded, mostly fine to medium-grained sand-sized quartz, some sand to gravel-sized shell, trace silt, 10Y 6/1 greenish gray (SP)		2		-63.7			
-65.0	6.3									
					100					
-67.2	8.5	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, few fine to coarse-grained sand-sized shell, trace silt, 10Y 5/1 greenish gray (SP)		3		-66.7			
-68.0	9.3									
					100					
-71.7	13.0	[Dotted pattern]	SAND, poorly-graded, mostly fine-grained sand-sized quartz, trace shell, trace silt, 10Y 4/1 dark greenish gray (SP)		4		-69.7			
		[Hatched pattern]	SAND, clayey, some fine-grained sand-sized quartz, some fine to coarse-grained sand-sized shell, little clay, 5G 5/1 greenish gray (SC)							
-73.5	14.8				100					

DRILLING LOG (Cont. Sheet)			INSTALLATION			SHEET 2 OF 2 SHEETS																					
PROJECT Flagler HSDR			COORDINATE SYSTEM/DATUM State Plane, FLE (U.S. Ft.)		HORIZONTAL NAD83	VERTICAL NAVD88																					
LOCATION COORDINATES X = 669,747 Y = 1,901,972			ELEVATION TOP OF BORING -58.7 Ft.																								
ELEV. (ft)	DEPTH (ft)	LEGEND	CLASSIFICATION OF MATERIALS	% REC.	BOX OR SAMPLE	RQD OR UD	REMARKS	BLOWS/ 1 FT.	N-VALUE																		
-75.5	16.8		CLAY, lean, few fine to coarse-grained sand-sized shell, few fine-grained sand-sized quartz, 5G 5/1 greenish gray (CL)	100			Vibracore																				
-77.2	18.5		SAND, silty, mostly fine to medium-grained sand-sized quartz, little fine gravel-sized shell, little silt, 10Y 6/1 greenish gray (SM)																								
-78.7	20.0			100			Vibracore (No Recovery)																				
<p>NOTES:</p> <ol style="list-style-type: none"> USACE Jacksonville is the custodian for these original files. Soils are field visually classified in accordance with the Unified Soils Classification System. Lost during recovery at depth 18.5'-20'. Laboratory Testing Results <table border="1"> <thead> <tr> <th>SAMPLE ID</th> <th>SAMPLE DEPTH</th> <th>LABORATORY CLASSIFICATION</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>1</td> <td>1.0/1.5</td> <td>SP*</td> </tr> <tr> <td>2</td> <td>5.0/5.5</td> <td>SP*</td> </tr> <tr> <td>3</td> <td>8.0/8.5</td> <td>SP*</td> </tr> <tr> <td>4</td> <td>11.0/11.5</td> <td>SP*</td> </tr> </tbody> </table> <p>*Lab visual classification based on gradation curve</p>										SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION	1	1.0/1.5	SP*	1	1.0/1.5	SP*	2	5.0/5.5	SP*	3	8.0/8.5	SP*	4	11.0/11.5	SP*
SAMPLE ID	SAMPLE DEPTH	LABORATORY CLASSIFICATION																									
1	1.0/1.5	SP*																									
1	1.0/1.5	SP*																									
2	5.0/5.5	SP*																									
3	8.0/8.5	SP*																									
4	11.0/11.5	SP*																									