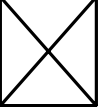
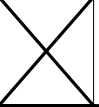


DRILLING LOG		DIVISION SOUTH ATLANTIC		INSTALLATION MOBILE DISTRICT		Hole No. V-59-94 SHEET 1 OF 1 SHEETS	
1. PROJECT BAY CO FL OFFSHORE PANAMA CITY BEACHES NOURISHMENT				10. SIZE AND TYPE OF BIT 3.5" x 25' VIBRACORE			
2. LOCATION (Coordinates or Station) ZONE FLN: N 411001 E 1604095				11. ELEVATION DATUM NGVD, FOOT U.S. COORDINATE DATUM STATE PLANE, NAD27, FOOT U.S.			
3. DRILLING AGENCY TET, INC.				12. MANUFACTURER'S DESIGNATION OF DRILL VIBRACORE			
4. HOLE NO. (As shown on drawing title and file number) V-59-94				13. TOTAL NO. OF OVER-BURDEN SAMPLES TAKEN		DISTURBED 5 UNDISTURBED 0	
5. NAME OF DRILLER CHARLIE WESTON				14. TOTAL NUMBER CORE BOXES 0			
6. DIRECTION OF HOLE <input checked="" type="checkbox"/> VERTICAL <input type="checkbox"/> INCLINED DEG. FROM VERTICAL				15. ELEVATION GROUNDWATER			
7. THICKNESS OF OVERBURDEN -				16. DATE HOLE STARTED 27 NOV 94 COMPLETED 27 NOV 94			
8. DEPTH DRILLED INTO ROCK -				17. ELEVATION TOP OF HOLE EL. -47.6			
9. TOTAL DEPTH OF HOLE 15.0 (EL. -62.6)				18. TOTAL CORE RECOVERY FOR BORING 0			
				19. SIGNATURE OF INSPECTOR BRAD RALPH DRAFTED <input type="checkbox"/> CHECKED <input type="checkbox"/> BCR BCR			
ELEVATION <small>a</small>	DEPTH <small>b</small>	LEGEND <small>c</small>	CLASSIFICATION OF MATERIALS (Description) <small>d</small>	% CORE RECOVERY OR W.C. <small>e</small>	BOX OR SAMPLE NO. <small>f</small>	REMARKS (Drilling time, water loss, depth of weathering, etc., if significant) <small>g</small>	
-47.6	0.0						
-49.4	1.8		(SP-SM) Gray medium to fine SAND		S-1	LAB: (SP-SM), 5% FINES (FINER THAN #200 SIEVE)	
	3.0						
	6.0		(SP) Gray to brown medium to fine SAND, trace shell		S-2	LAB: (SP), 3% FINES	
-54.6	7.0						
	9.0		(SP-SM) Gray medium to fine SAND		S-3	LAB: (SP-SM), 6% FINES	
-57.4	9.8						
	11.7		(SM) Gray silty medium to fine SAND		S-4	LAB: (SP-SM), 11% FINES	
-59.3							
-60.9	13.3		(SP-SM) Gray medium to fine SAND		S-5		
-62.6	15.0		SAMPLE NOT RECOVERED				
						B.O.H.	