
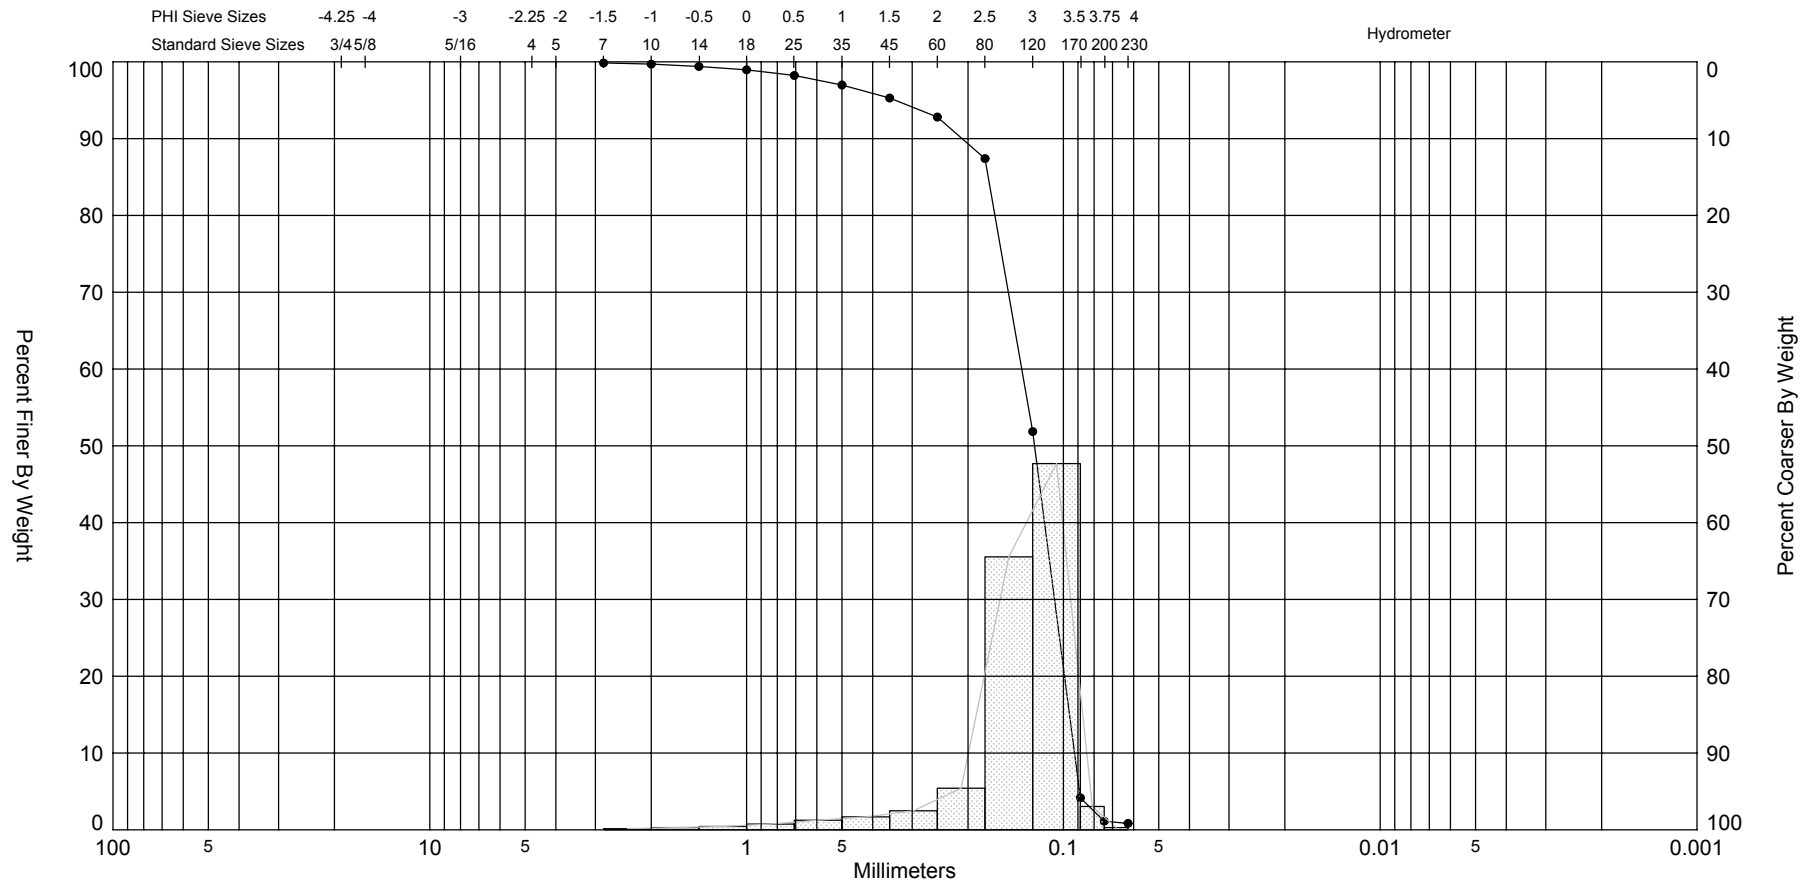



Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-4 #1.0		-23.7		SP	#200 - 0.61 #230 - 0.23	3.13	3.02	-3.31	18.29	0.52	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	972,048
											Northing (Y):	905,419
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29


SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 9/7/04



SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 9/7/04

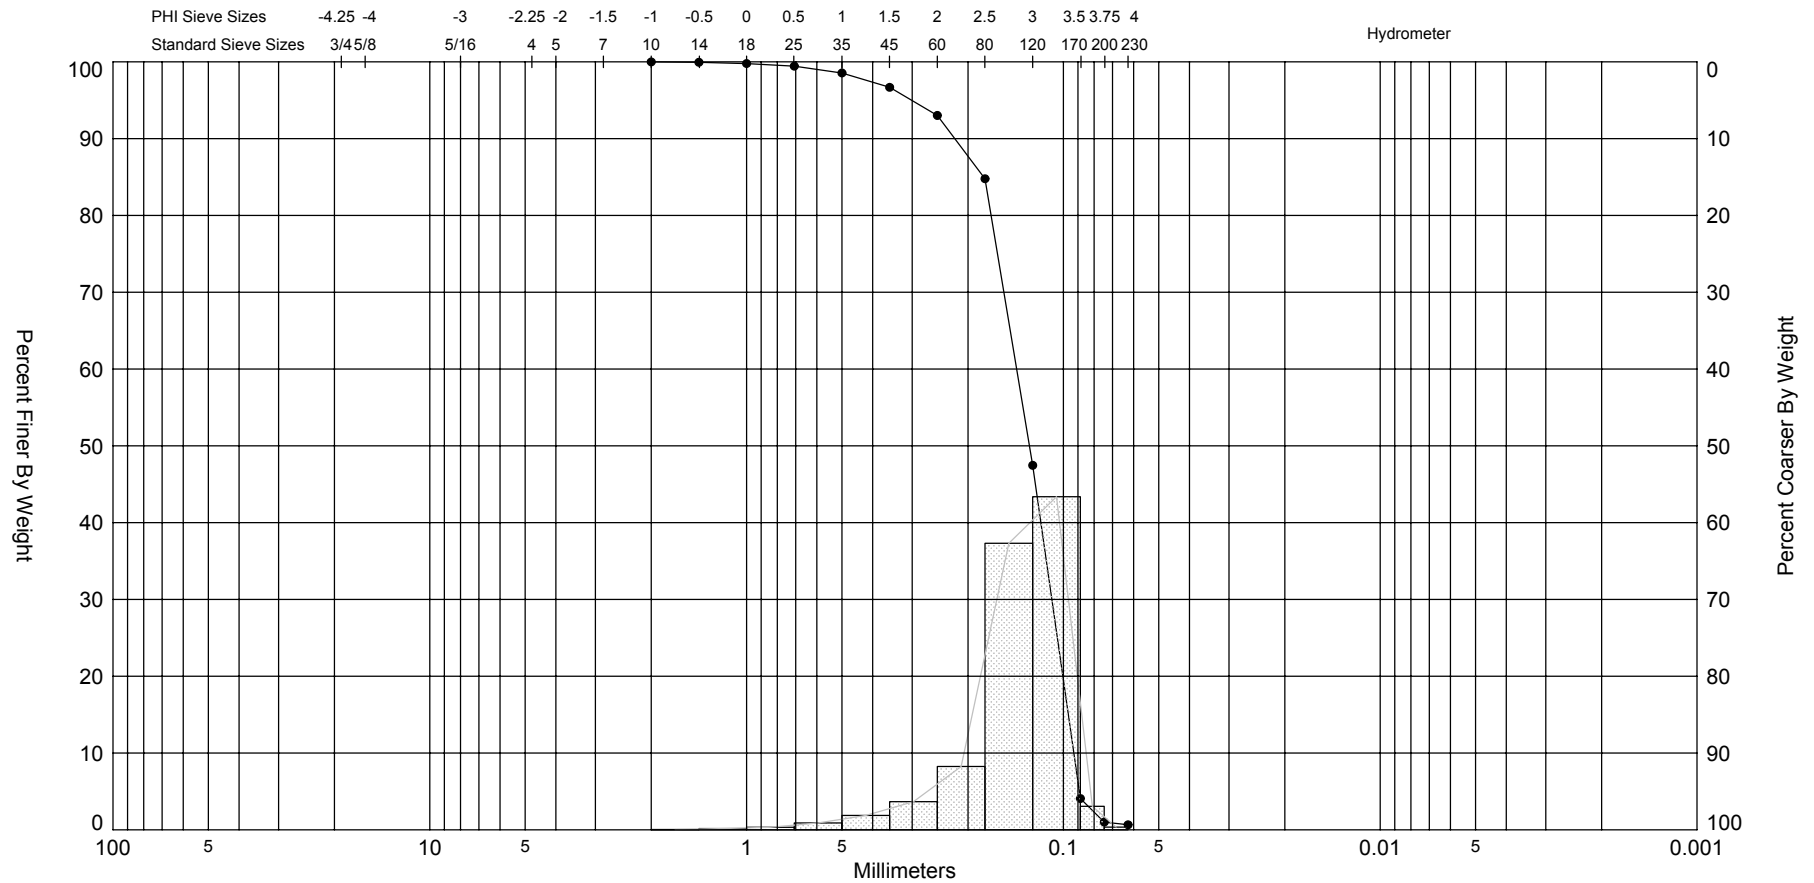


SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 9/7/04

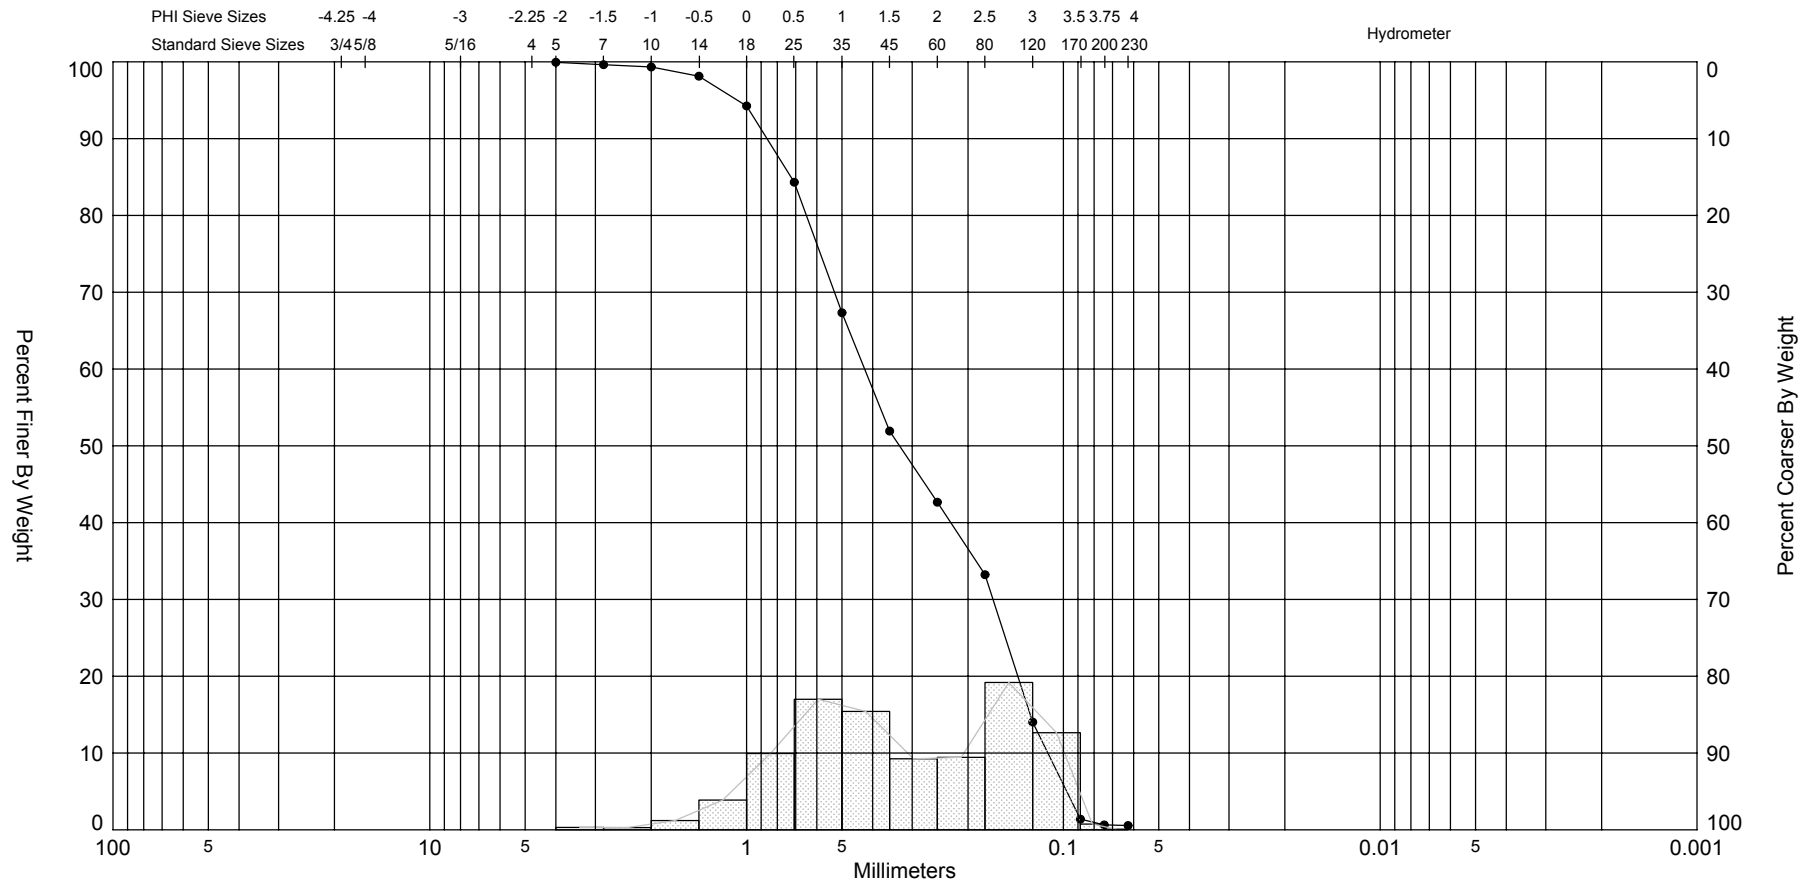

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-4 #11.0	—●—	-33.7		SP	#200 - 0.64 #230 - 0.56	1.6	1.67	-0.18	2.09	1.12	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	972,048
											Northing (Y):	905,419
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29

SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 9/7/04

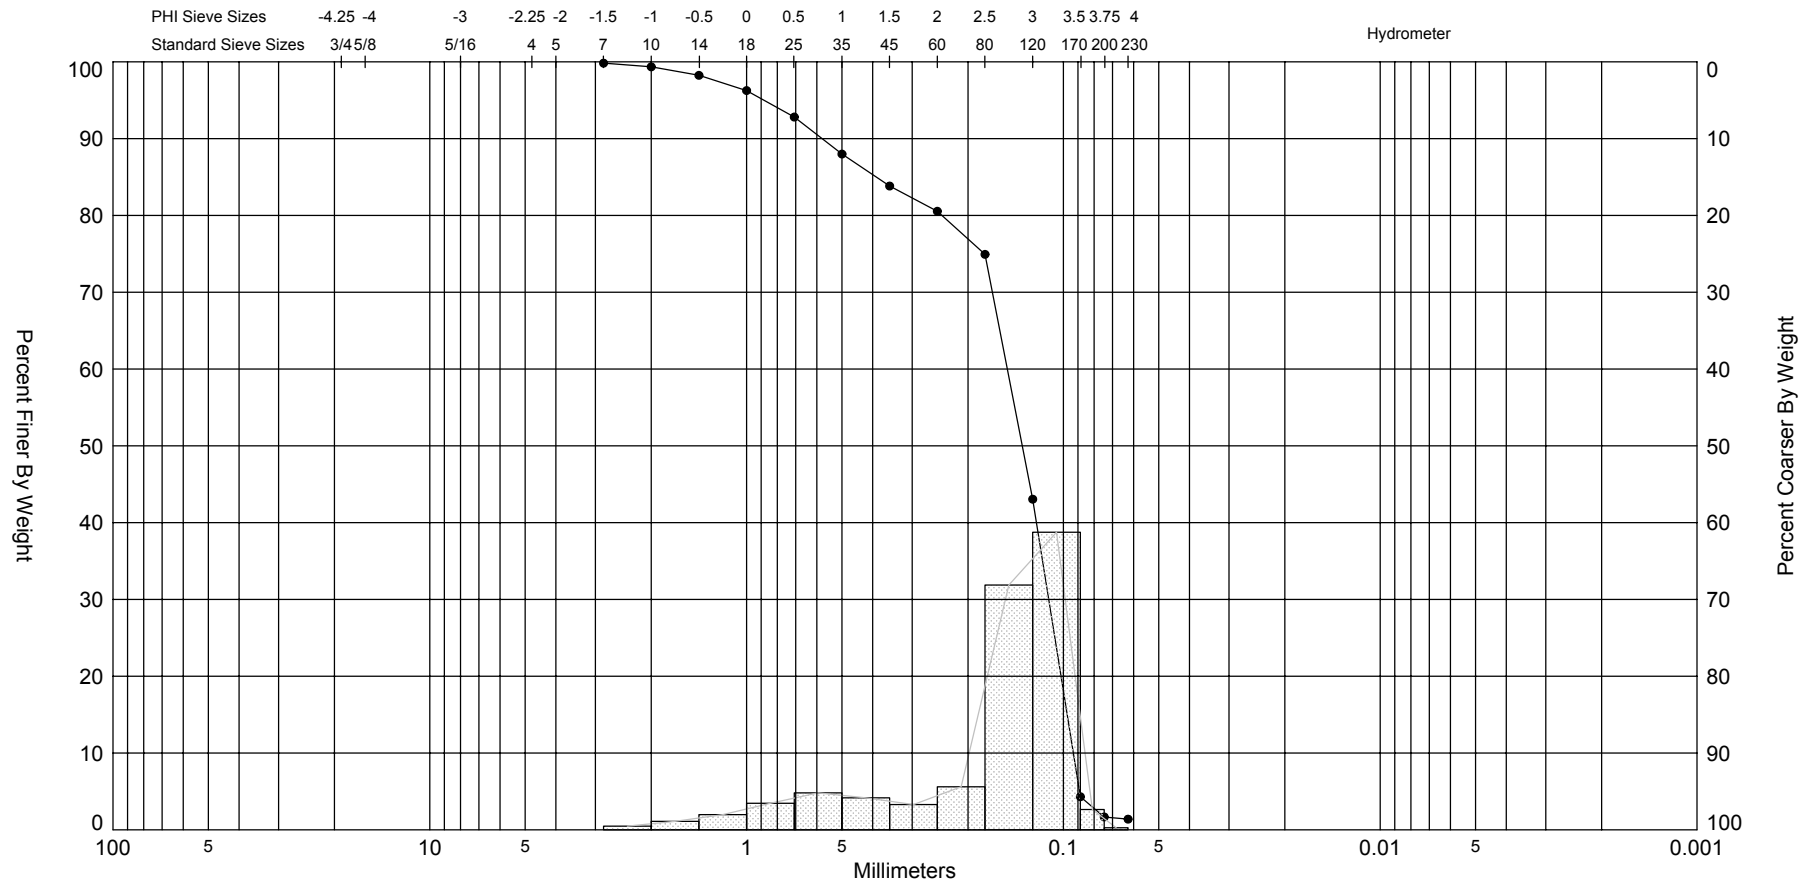

Scientific Environmental Applications, Inc.
5575 Willoughby Drive
Melbourne, FL 32934
(321) 254-2708
Seapp1@aol.com

Sample Information	
Project Name:	Palm Beach County Vibracore 2004
Analysis Date:	07-01-04
Analyzed By:	SEA Inc.
Easting (X):	972,048
Northing (Y):	905,419
Horizontal System:	NAD 1983
Vertical System:	NAVD 29