


Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-14 #2.0	—●—	-30.4		SP	#200 - 1.52 #230 - 1.18	3.14	3.08	-2.65	22.4	0.33	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,165
											Northing (Y):	892,429
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29


SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

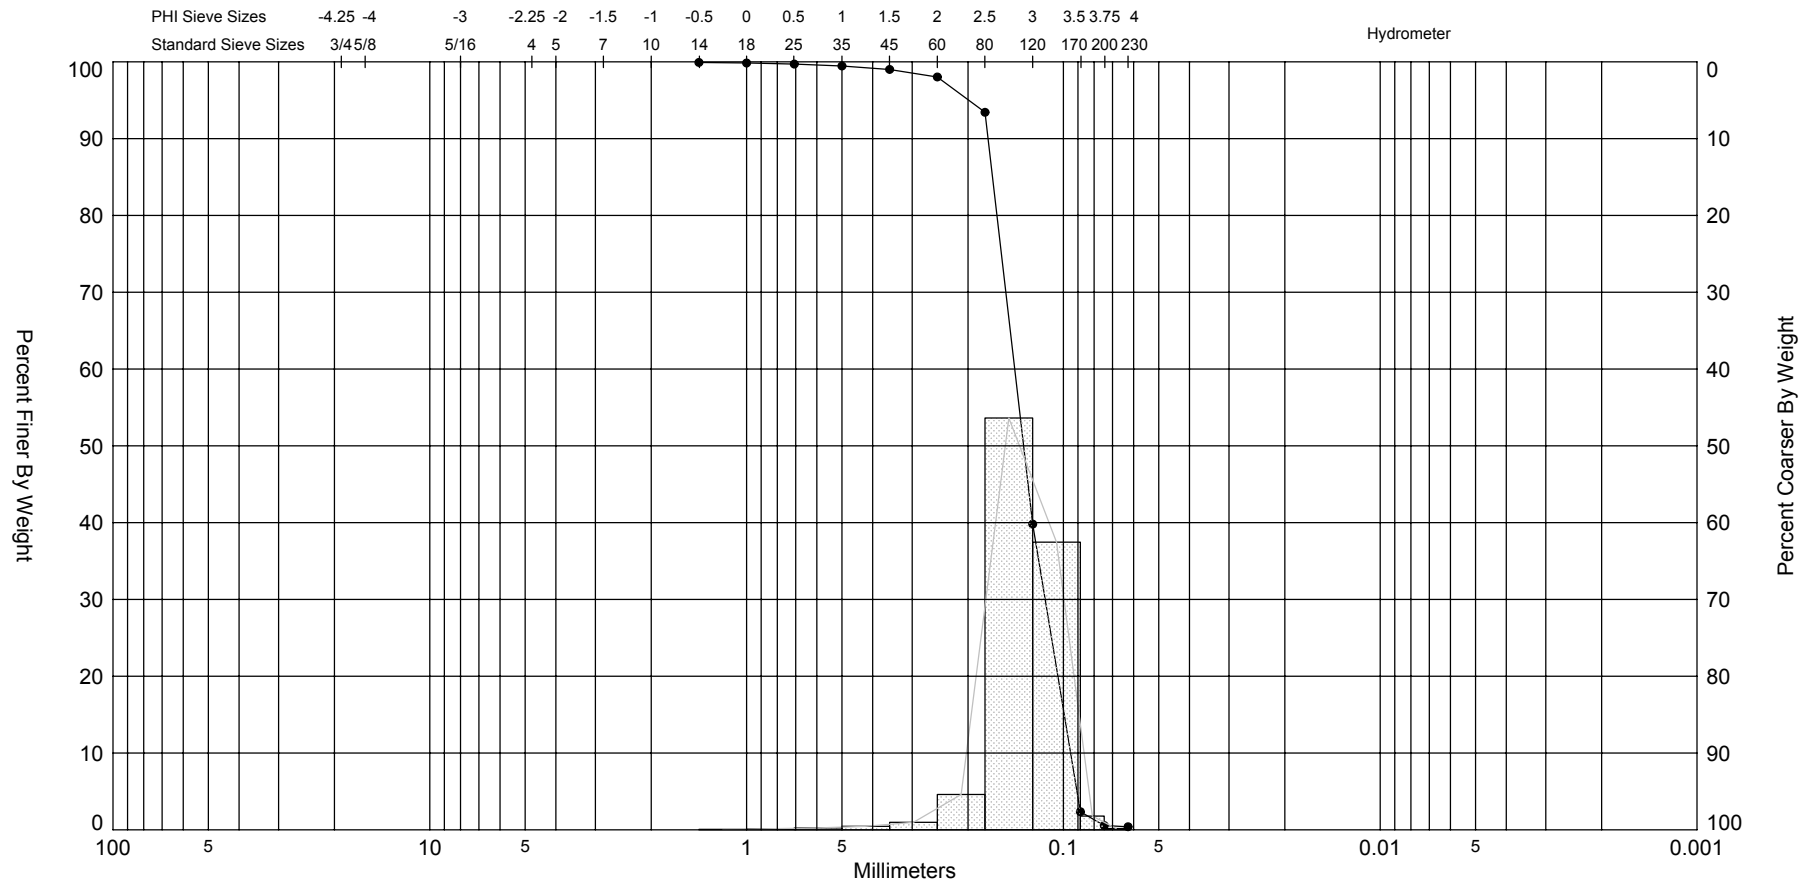

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-14 #6.0	—●—	-34.4		SP	#200 - 0.56 #230 - 0.40	2.9	2.91	-1.88	13.11	0.38	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,165
											Northing (Y):	892,429
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29


SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

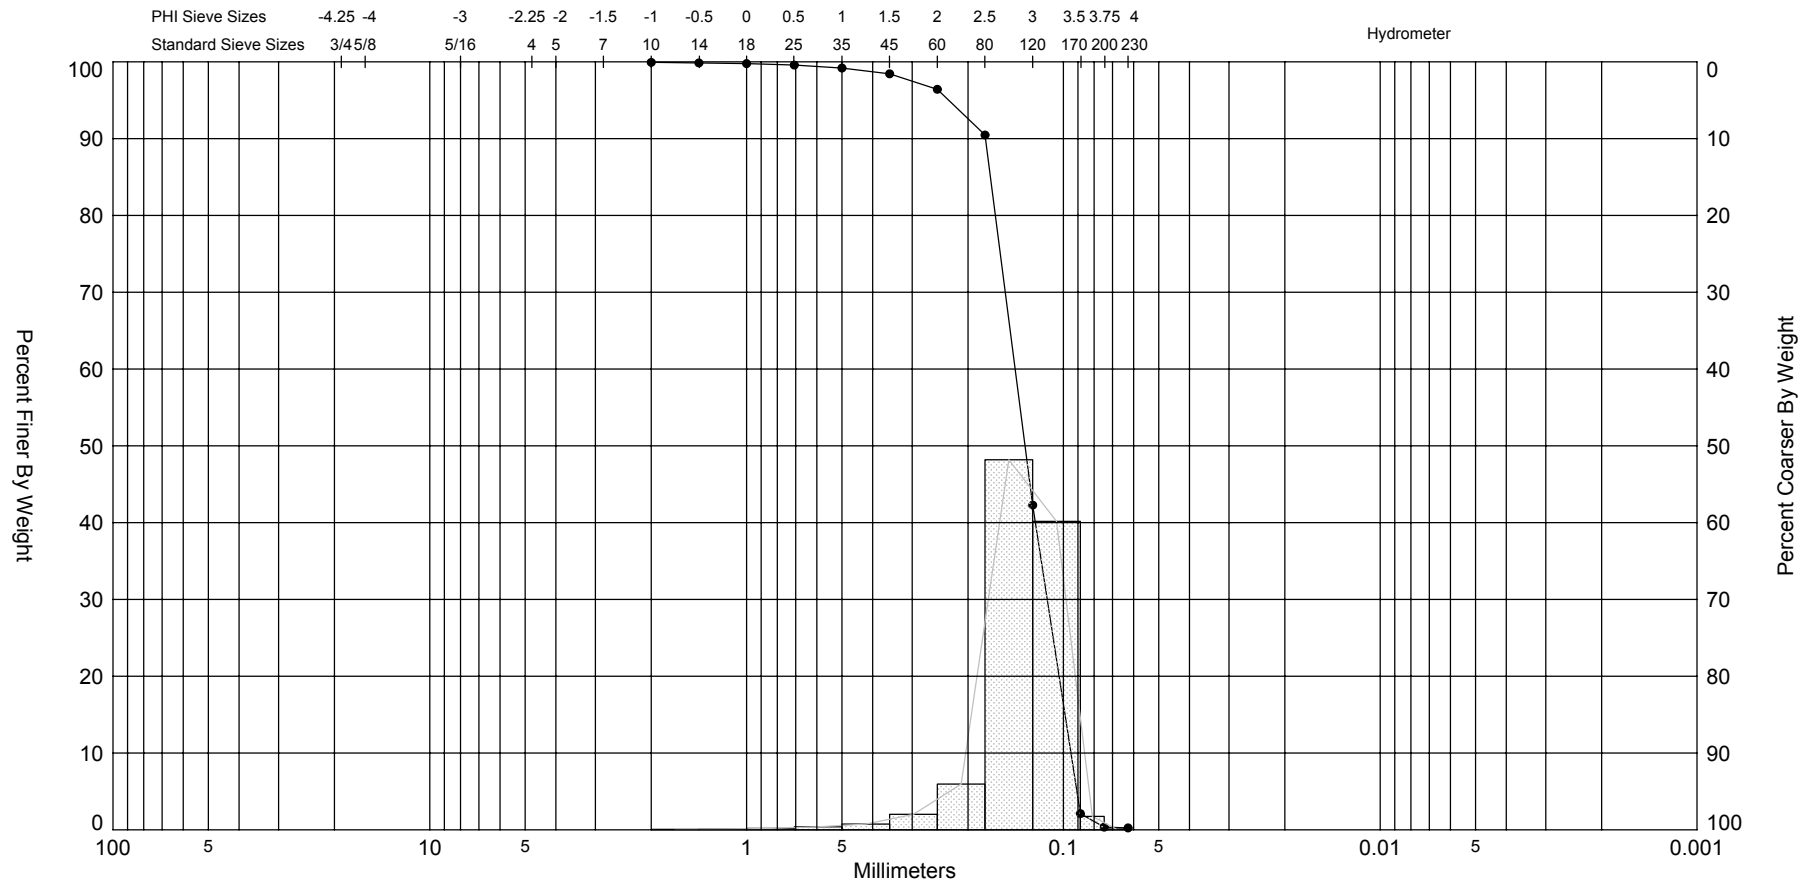

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	


Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-14 #11.0	—●—	-39.4		SP	#200 - 0.35 #230 - 0.25	2.92	2.89	-2.23	13.46	0.44	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,165
											Northing (Y):	892,429
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29

SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

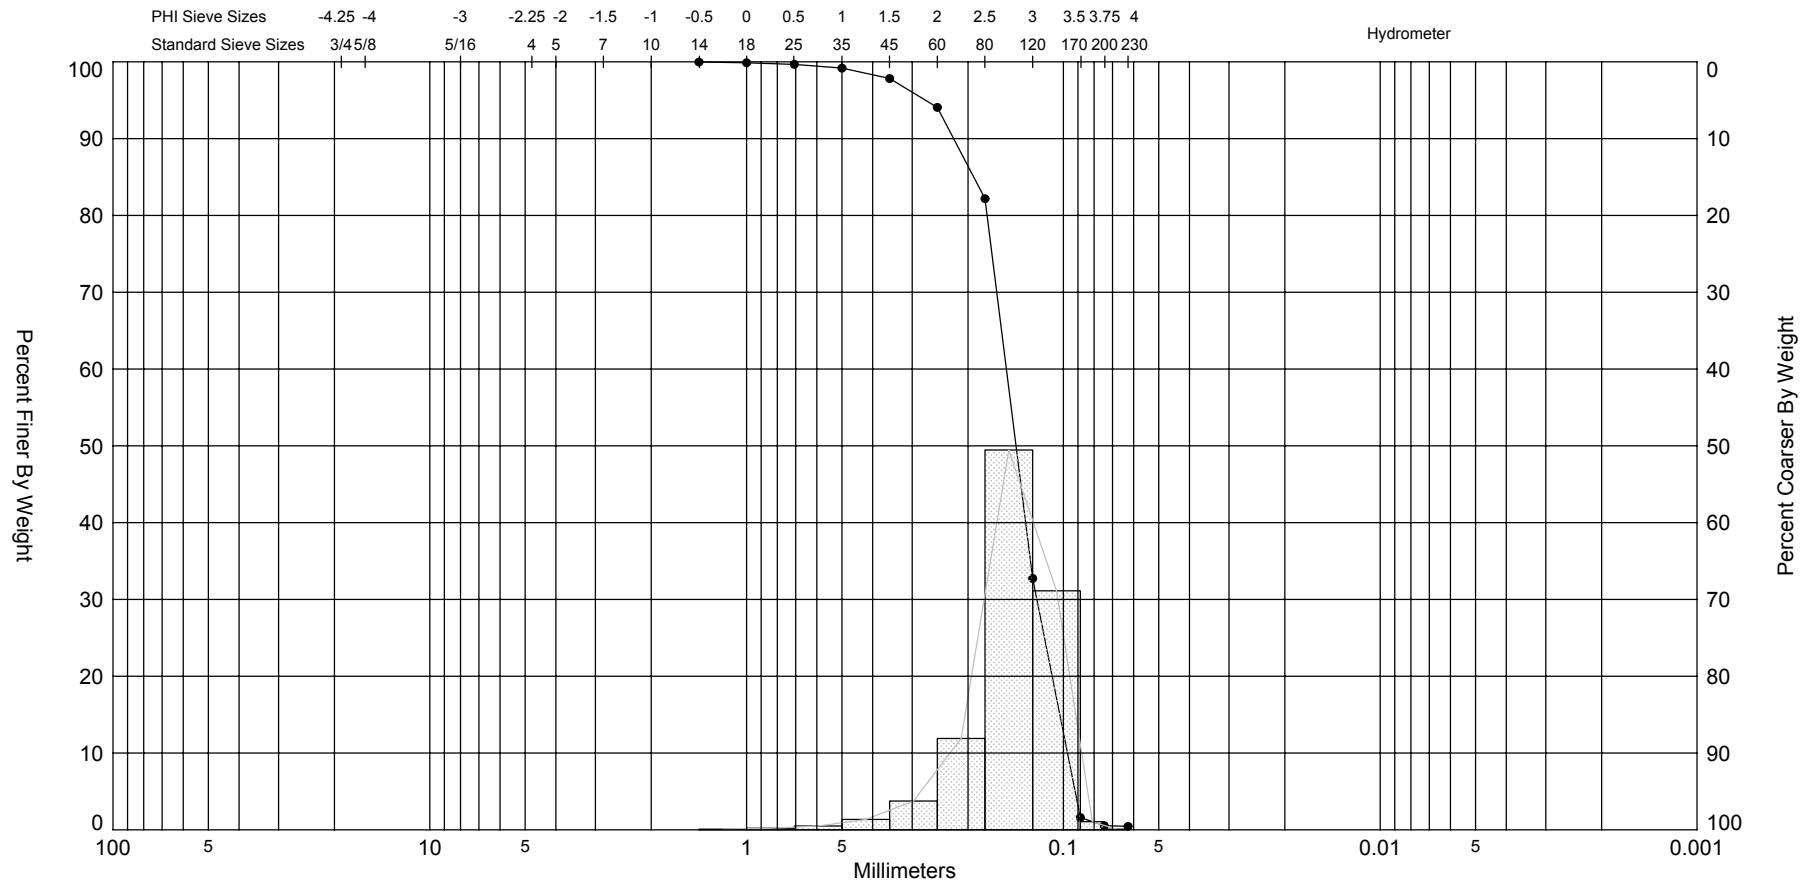

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-14 #15.0	—●—	-43.4		SP	#200 - 0.54 #230 - 0.45	2.83	2.78	-1.58	7.79	0.48	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,165
											Northing (Y):	892,429
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29

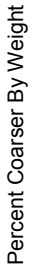

Silt and Clay

Scientific Environmental Applications, Inc.  
5575 Willoughby Drive  
Melbourne, FL 32934  
(321) 254-2708  
Seapp1@aol.com

Project Name:	Palm Beach County Vibracore 2004
Analysis Date:	07-01-04
Analyzed By:	SEA Inc.
Easting (X):	974,165
Northing (Y):	892,429
Horizontal System:	NAD 1983
Vertical System:	NAVD 29