


Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-7 #0.5	—●—	-51.5		SP	#200 - 0.52 #230 - 0.46	1.37	1.32	-0.73	3.19	1.37	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,318
											Northing (Y):	903,865
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29


SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

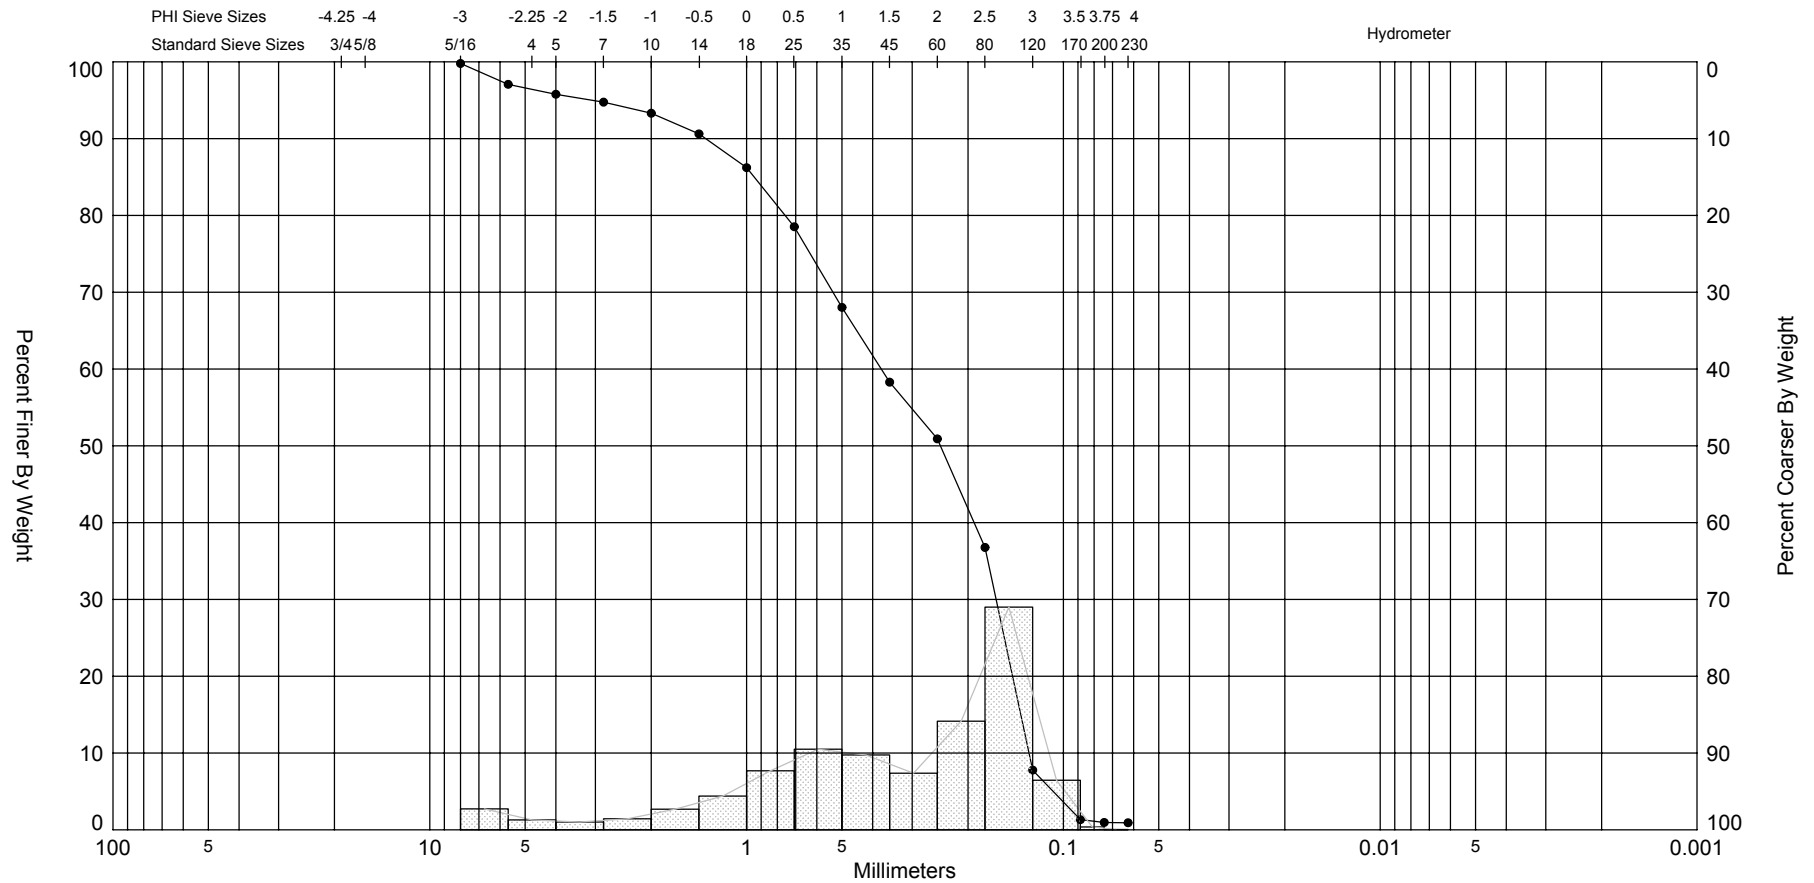

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-7 #1.0	—●—	-52.0		SP	#200 - 0.96 #230 - 0.92	2.03	1.54	-1.1	3.73	1.46	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,318
											Northing (Y):	903,865
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29


SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

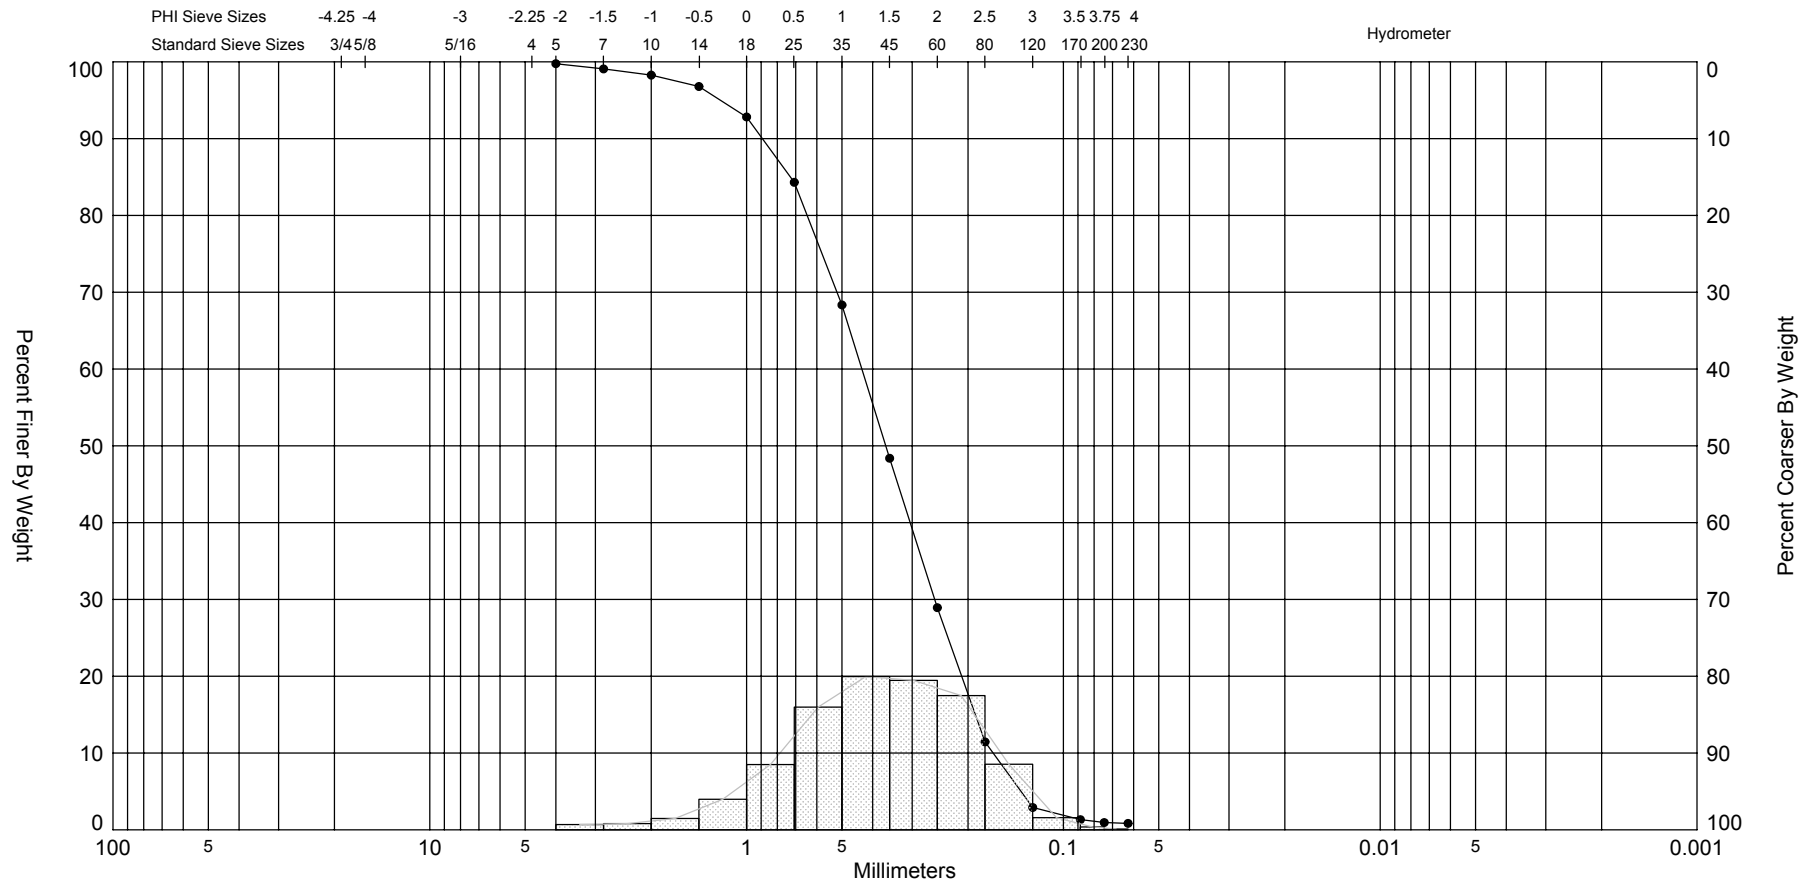

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-7 #4.0	—●—	-55.0		SP	#200 - 0.95 #230 - 0.84	1.46	1.4	-0.46	3.33	0.94	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,318
											Northing (Y):	903,865
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29


SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

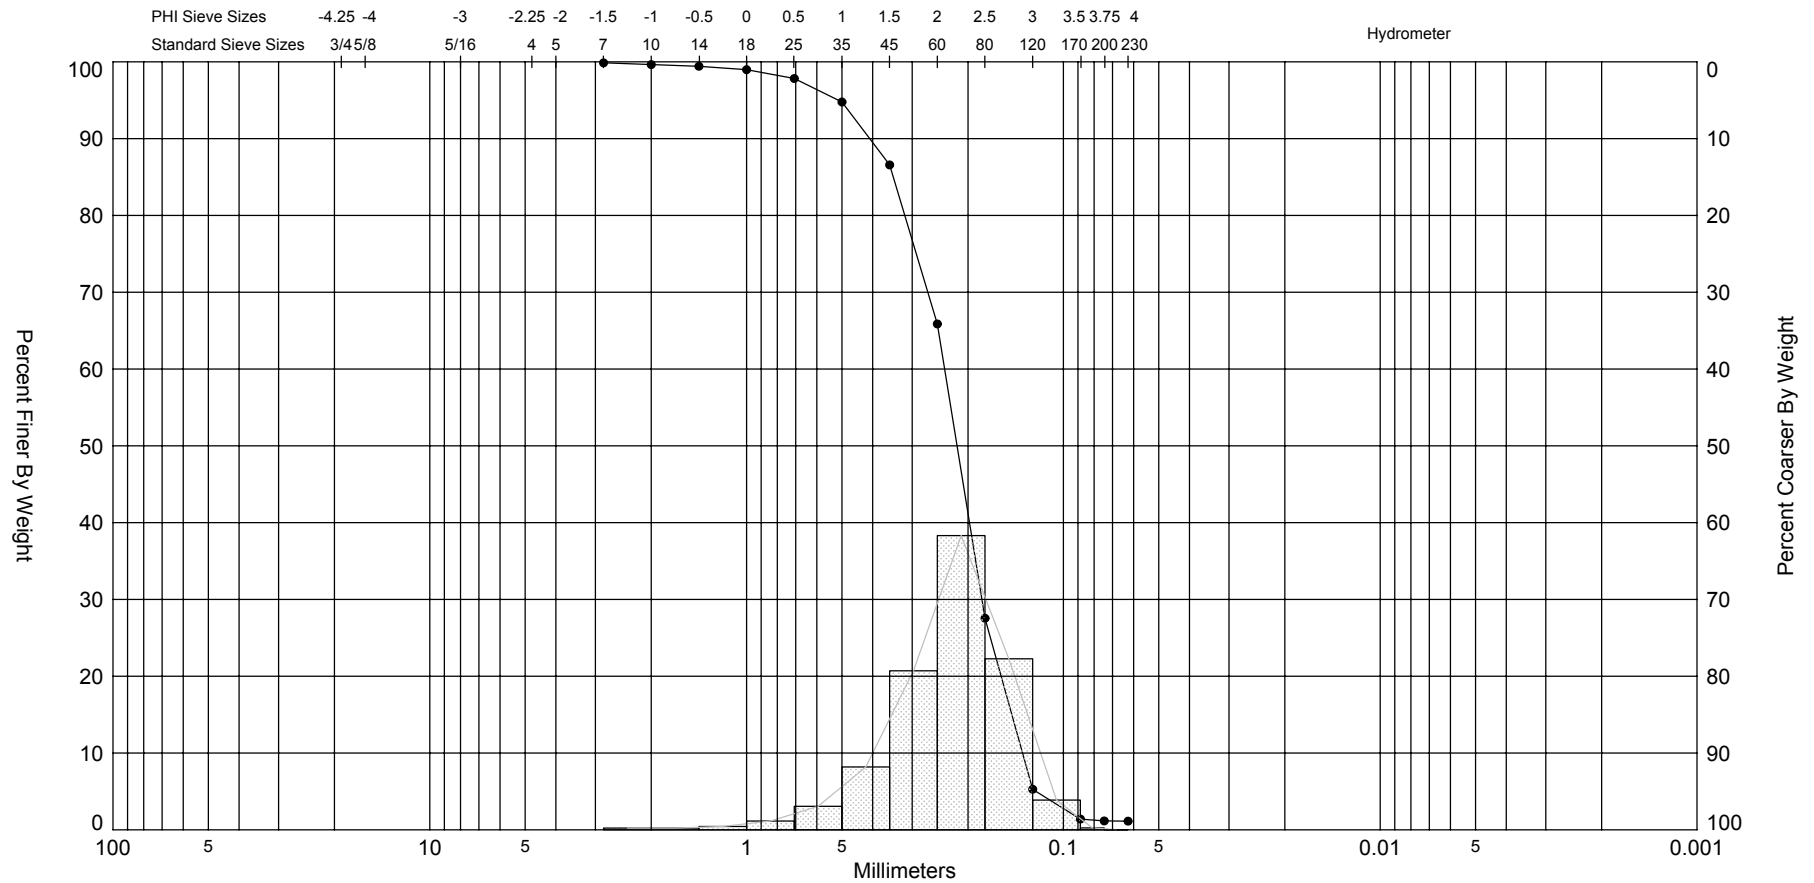

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-7 #9.0	—●—	-60.0		SP	#200 - 1.16 #230 - 1.13	2.21	2.12	-1.13	5.95	0.64	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,318
											Northing (Y):	903,865
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29


SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

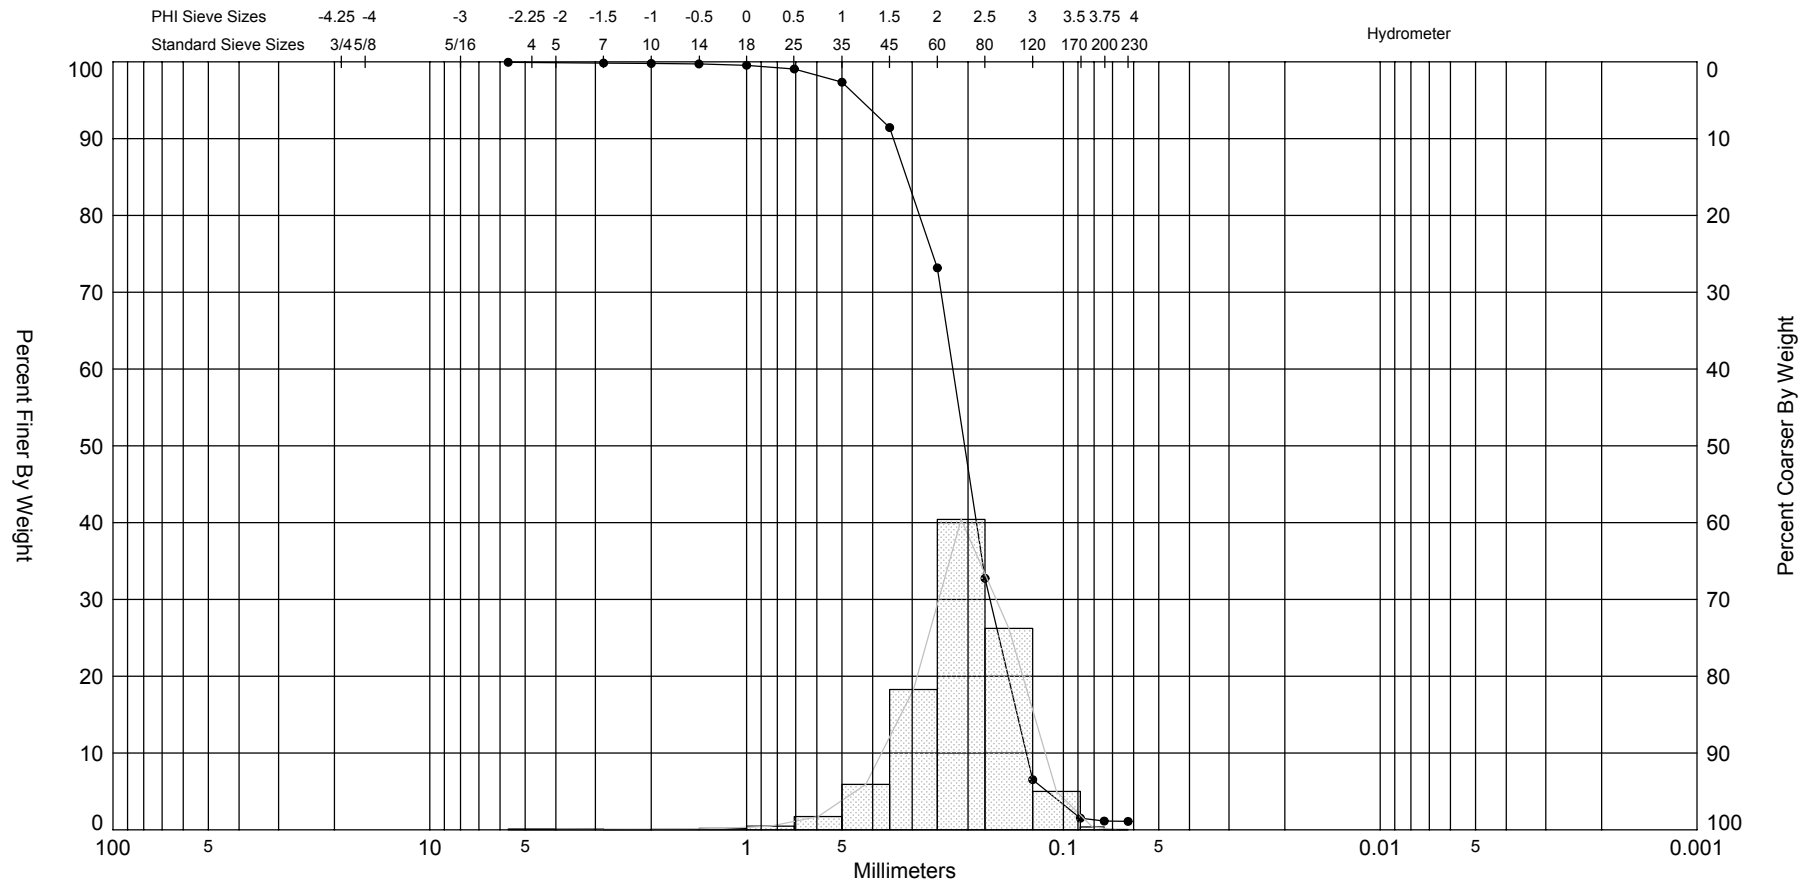

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-7 #14.0	—●—	-65.0		SP	#200 - 1.14 #230 - 1.10	2.29	2.24	-1.13	7.51	0.57	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,318
											Northing (Y):	903,865
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29

SIEVE ANALYSIS: SINGER\_IS.GPJ FL DEP ROSS.GDT 9/7/04

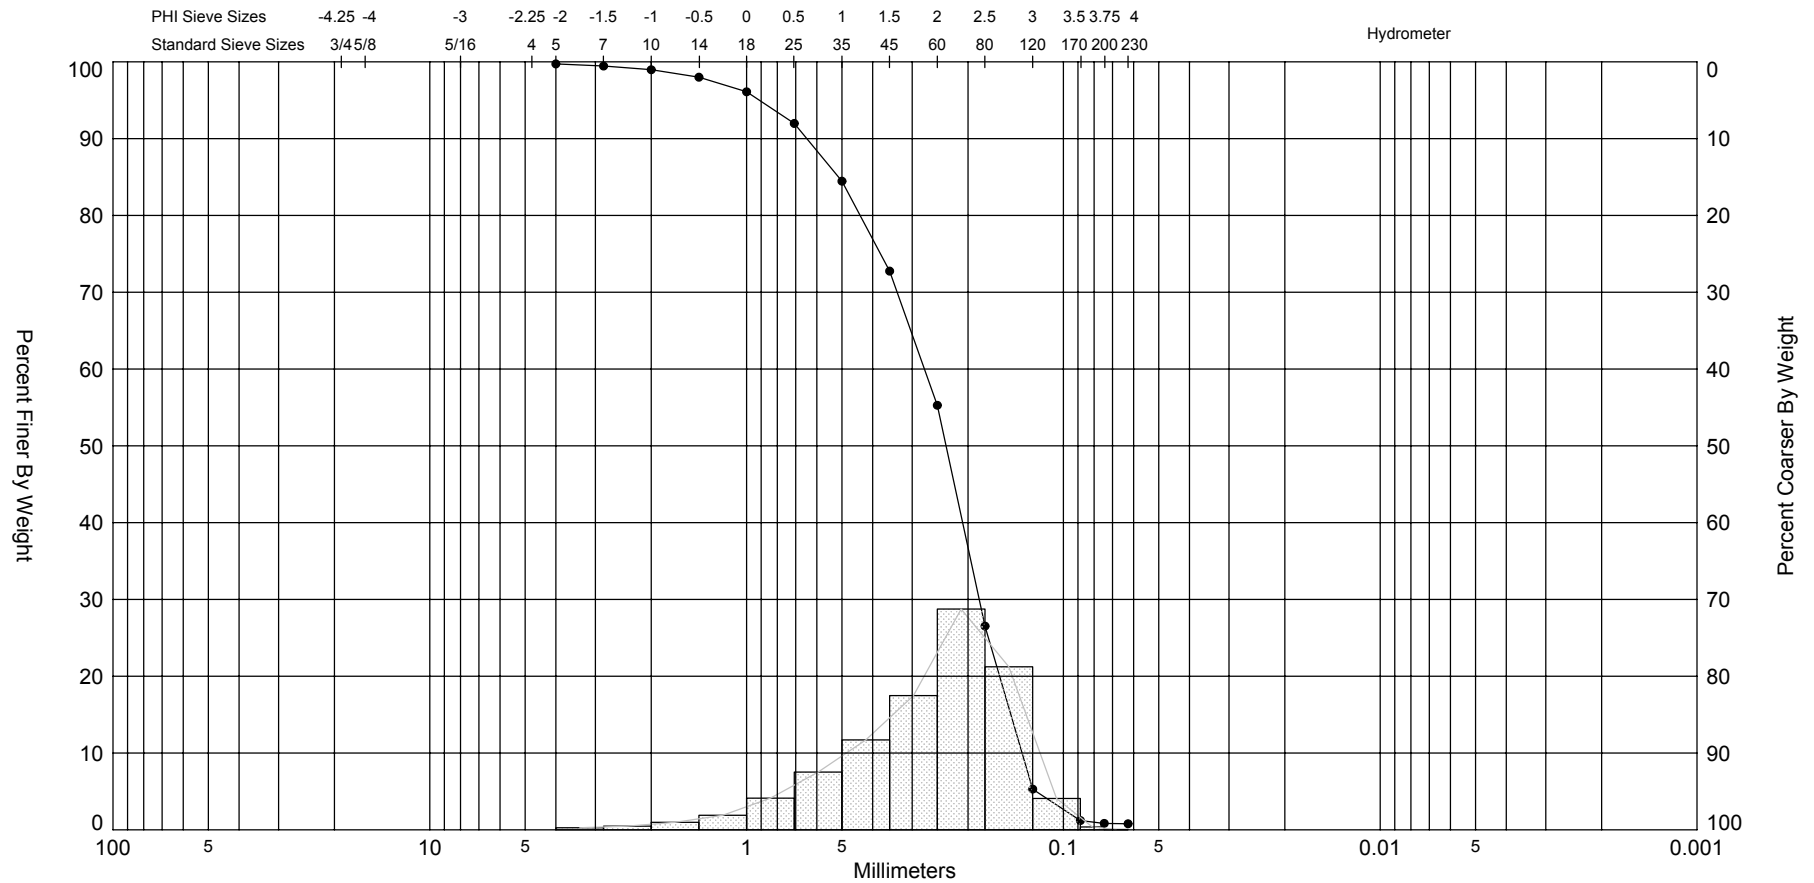

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev.	Comments	USCS	% Fines	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-7 #Comp	—●—	-70.0	Composite sample 0 - 14.0 ft.	SP	#200 - 0.84 #230 - 0.79	2.09	1.89	-1.02	4.19	0.89	Project Name:	Palm Beach County Vibracore 2004
											Analysis Date:	07-01-04
											Analyzed By:	SEA Inc.
Scientific Environmental Applications, Inc. 5575 Willoughby Drive Melbourne, FL 32934 (321) 254-2708 Seapp1@aol.com											Easting (X):	974,318
											Northing (Y):	903,865
											Horizontal System:	NAD 1983
											Vertical System:	NAVD 29